



# **Performance Silicone Air Intake Kit**

## **Part Number: 57-2122**

**Subaru 2022-2025 BRZ 2.4L**  
**Toyota 2022-2025 GR86 2.4L**

## **Installation Instructions**

For technical inquiries please email us at [tech@hpsperformance.com](mailto:tech@hpsperformance.com)

In the email, please include the following information for faster response:

- Year / Make / Model / Engine of your vehicle.
- If it is a fitment issue, please include pictures showing the fitment problem.
- If there are missing parts, please list the part number(s) from the bill of materials on the 2nd page.
- Optional but recommended – Your contact phone number and preferred call back time.

You can also give us a call via 626-747-9200 for tech support Monday-Friday, 9:00am-5:00pm Pacific Time.

# Bill of Materials

## Kit Number: 57-2122

Line #	Description	Part Number	Qty
1	Silicone Tube	57-2122	1
2	T-Bolt Clamp, 86-94mm	SSTC-86-94	1
3	Embossed Clamp, 12-22mm	EMSC-12-22	1

- Before installing any parts of this intake kit, please read the instructions thoroughly.
- Verify the contents of this intake kit before disassembling your vehicle.
- DO NOT INSTALL IF ANY PARTS ARE MISSING OR DAMAGED. CONTACT [tech@hpsperformance.com](mailto:tech@hpsperformance.com) IMMEDIATELY. WE ARE NOT RESPONSIBLE FOR ANY DAMAGE CAUSED DUE TO IMPROPER INSTALLATION.
- Installation requires moderate mechanical skills. A qualified mechanic is highly recommended.
- Do not attempt to install the intake kit while the engine is hot.
- This installation may require removal of coolant lines that may be hot.
- For technical inquiries, please email us at [tech@hpsperformance.com](mailto:tech@hpsperformance.com)

## **PLEASE READ CAREFULLY BEFORE INSTALLATION!**


This installation is not for the novice customer. Install this product with EXTREME caution! Misuse of this product can destroy your engine! If you are not mechanically inclined, please have a professional automotive mechanic install this kit.

***NOTE: HPS holds no responsibility for any engine damage that results from misuse of this product.***

## **GETTING STARTED**


1. Turn the ignition OFF and disconnect the vehicle's negative battery cable. If the engine has run within the past two hours let it cool down.

NOTE: Disconnecting the negative battery cable erases pre-programmed electronic memories. Write down all memory settings before disconnecting the negative battery cable. Some radios will require an anti-theft code to be entered after the battery is reconnected. The anti-theft code is typically supplied with your owner's manual. In the event your vehicle's anti-theft code cannot be recovered, contact an authorized dealership to obtain your vehicle's anti-theft code. We also highly recommend NOT discarding any stock parts after the installation.

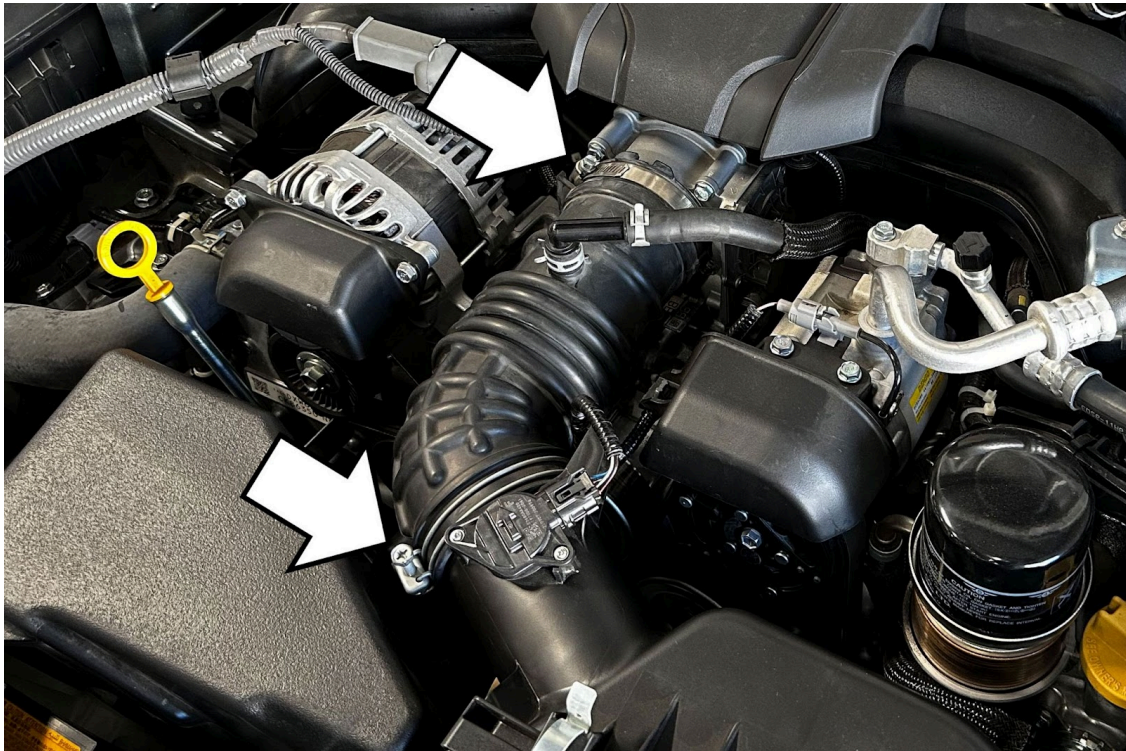


2. Loosen the clamps securing the stock intake tube to the throttle body and MAF housing.



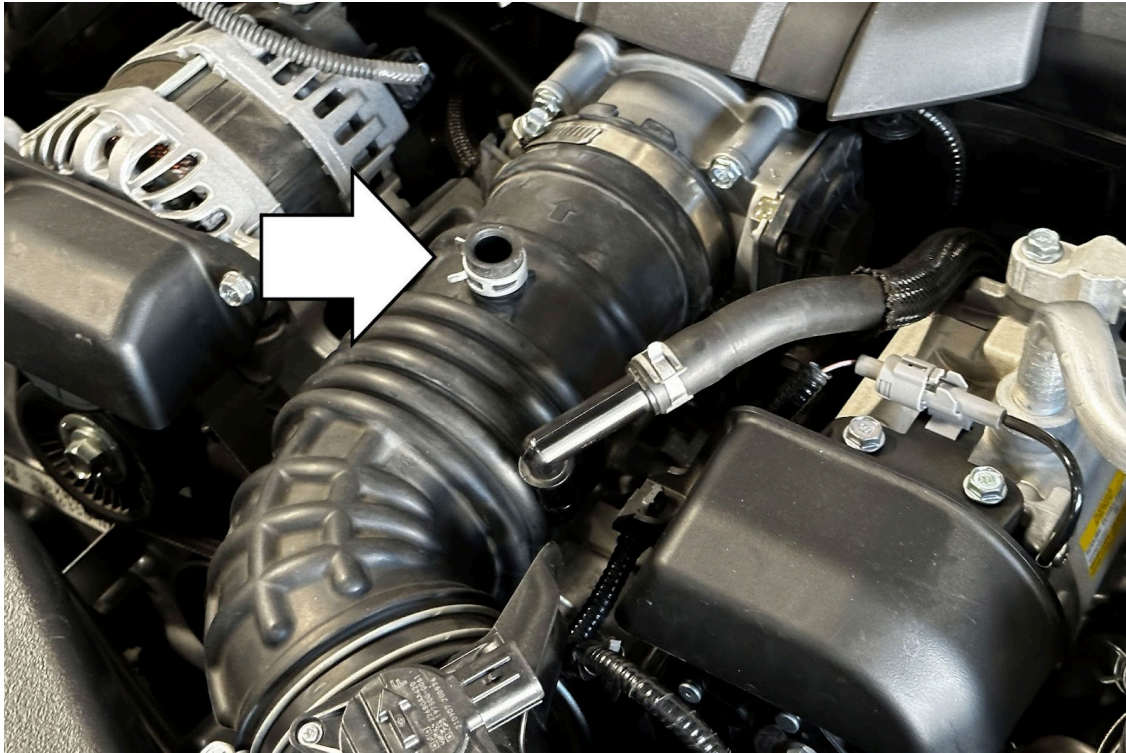


3. Disconnect the 90 degree hose connector from the stock intake tube, then remove the intake hose from the engine bay.

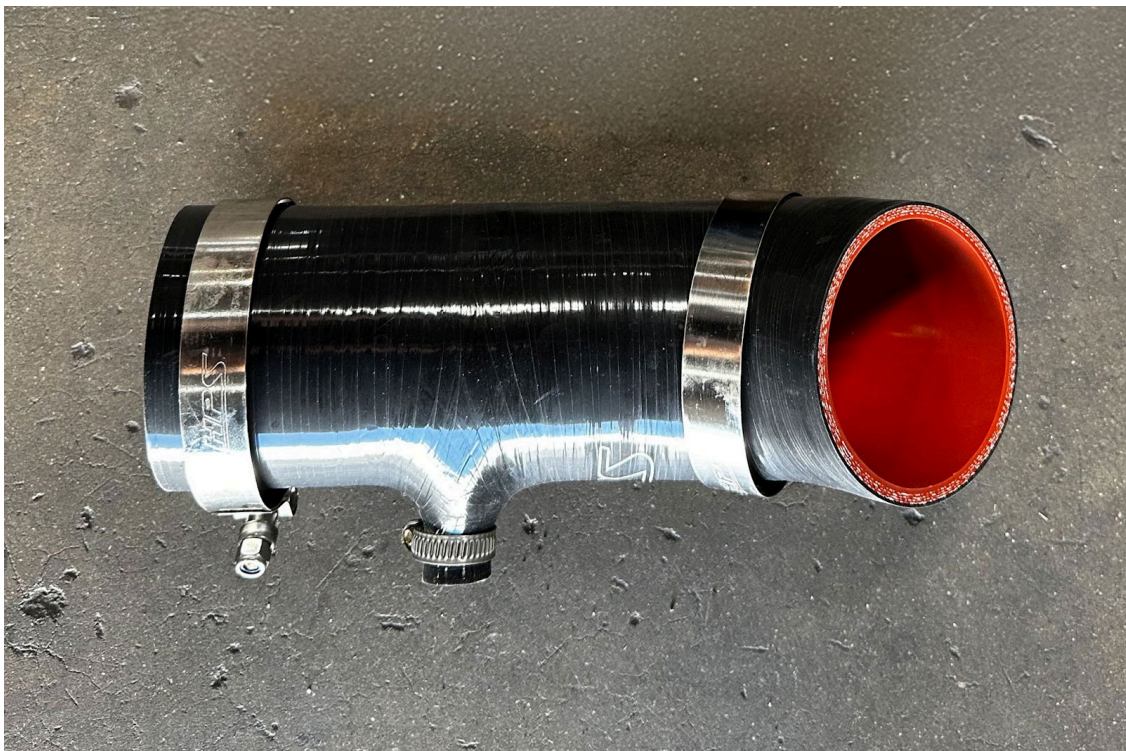


4. Place the provided clamps onto their respective ports on the HPS silicone intake tube.



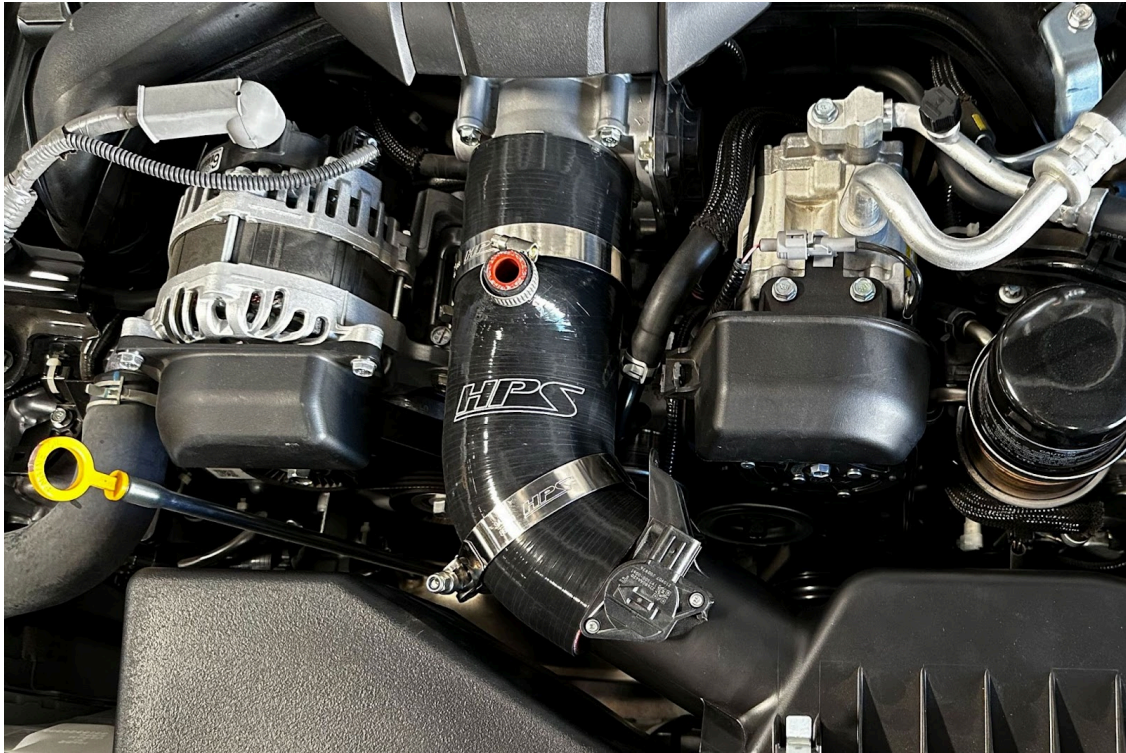


5. Squeeze the center of the HPS intake tube to guide it onto the throttle body and MAF housing.

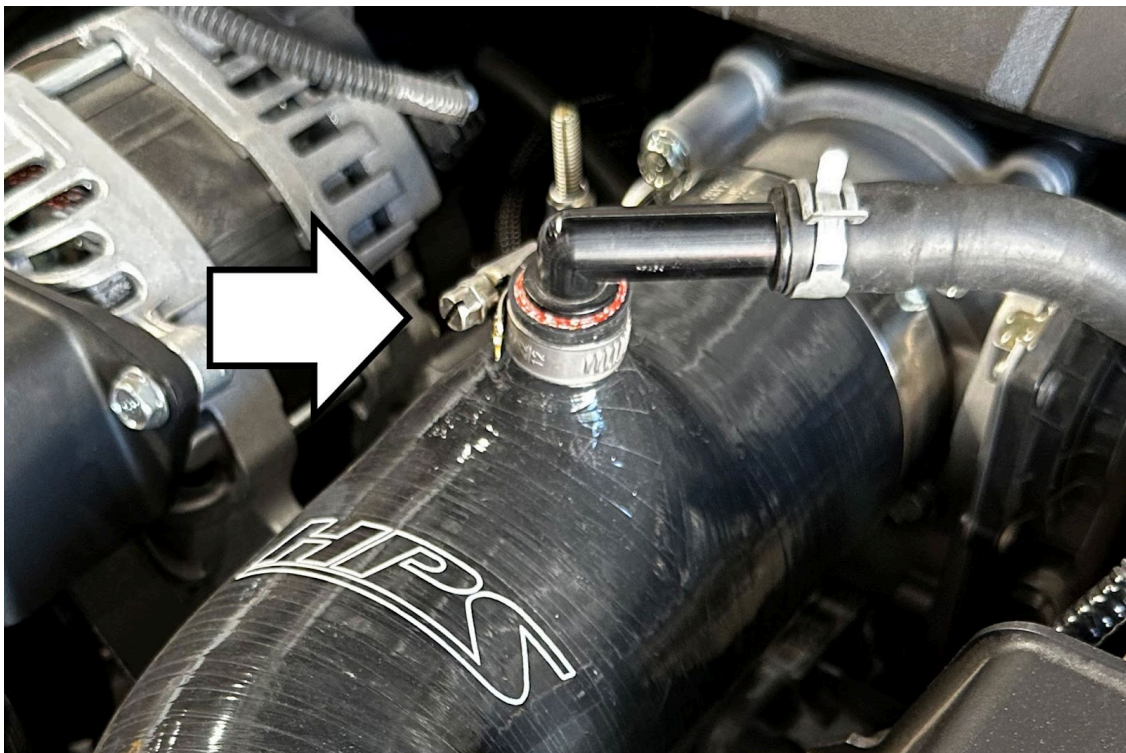

6. Connect the 90 degree connector to the HPS intake tube and secure the clamp.



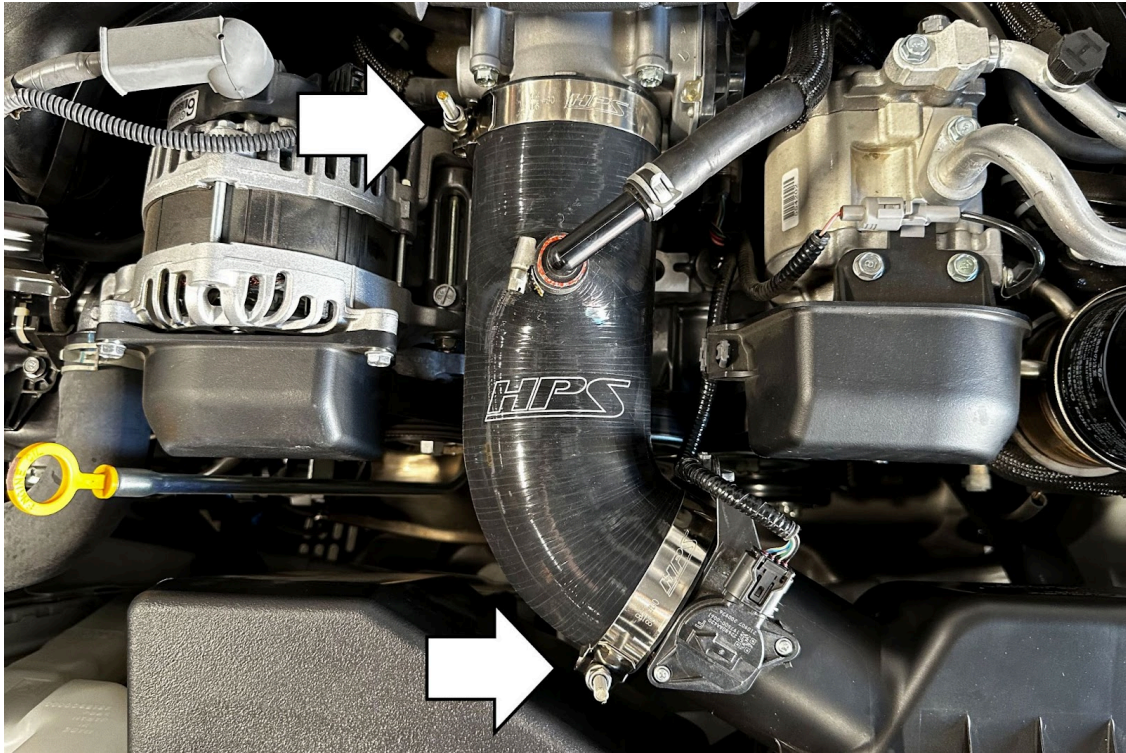

7. Fasten the T-bolt clamps to secure the HPS silicone intake tube.

## **FINAL STEPS**

Once the intake has been positioned, tighten all of the clamps and secure all of the parts.

Upon completion of the installation, reconnect the negative battery terminal before you start the engine. Double check to make sure everything is tight and properly positioned before starting the vehicle.

Start the engine. Let the car idle for 3 minutes. Perform a final inspection before driving. Listen carefully for any odd noises, rattles and/or air leaks prior to taking it for a test drive. If any problems arise go back and check the vacuum lines, hoses and clamps that may be causing leaks or rattles and correct the problem.


Periodically, recheck the alignment of the intake kit and make sure there is proper clearance around and along the length of the intake. Failure to follow proper maintenance procedures may cause damage to the intake and will void the warranty.



HPS Performance Silicone Air Intake Kit  
2022-2025 Toyota GR86 2.4L  
2022-2025 Subaru BRZ 2.4L  
Part Number: 57-2122

Maximum Horsepower Gains = 4 whp @ 6000 rpm


Tested Vehicle 2022 Subaru BRZ 2.4L

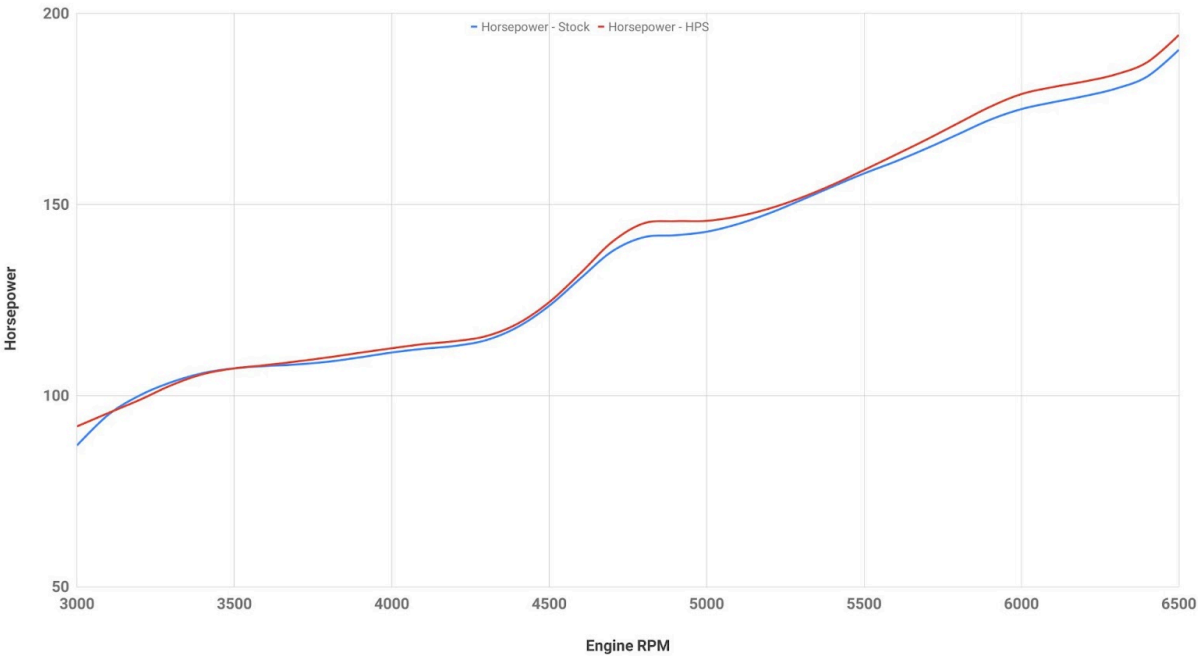

HPS Performance Silicone Air Intake Kit  
2022-2025 Toyota GR86 2.4L  
2022-2025 Subaru BRZ 2.4L  
Part Number: 57-2122

Maximum Torque Gains = 3.5 ft/lb @ 6000 rpm

Tested Vehicle 2022 Subaru BRZ 2.4L

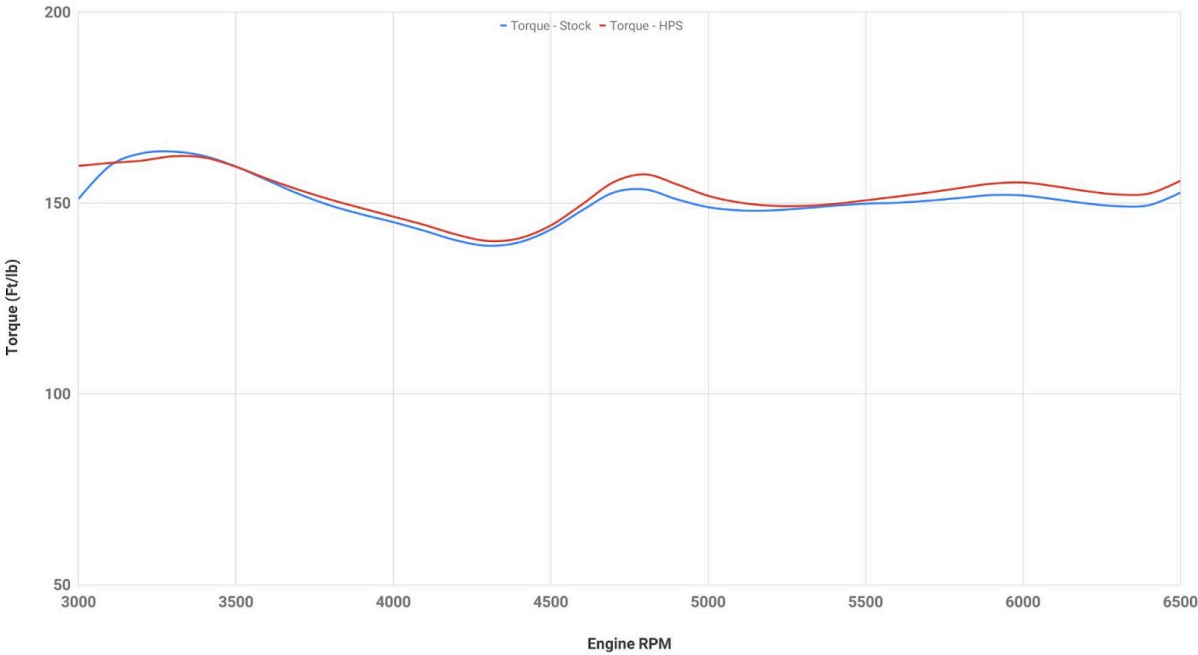



**Also available for:**  
**Subaru 2022-2025 BRZ 2.4L**  
**Toyota 2022-2025 GR86 2.4L**



**HPS Performance Drop-In Air Filter**  
**Part Number [HPS-457318](#)**



**HPS Stainless Steel Magnetic Differential Oil  
Drain Plug Bolt**  
**Part Number [MDP-M18x150-L30](#)**



**HPS Performance Stainless Steel Magnetic  
Engine Oil Drain Plug**  
**Part Number [MDP-M16x150](#)**

**Contact an authorized HPS Performance dealer or  
visit us at [hpsperformance.com](https://hpsperformance.com) for more details**